


AMERICANS WITH DISABILITIES ACT

Title II & III Compliance Observations & Findings

LOCATION: *1255 Hempstead Turnpike, Uniondale, NY 11553*

OBSERVED OCCUPANT: *Nassau Veterans Memorial Coliseum*

Purpose: *To provide findings upon observation of the location noted regarding compliance with Title II & III of the Americans with Disabilities Act of 1990 (42 U.S.C. 12181, 12131), which prohibits discrimination on the basis of disability by public accommodations/public entities and requires public entities, places of public accommodation and commercial facilities to be designed, constructed, and altered in compliance with the accessibility standards established by this part.*

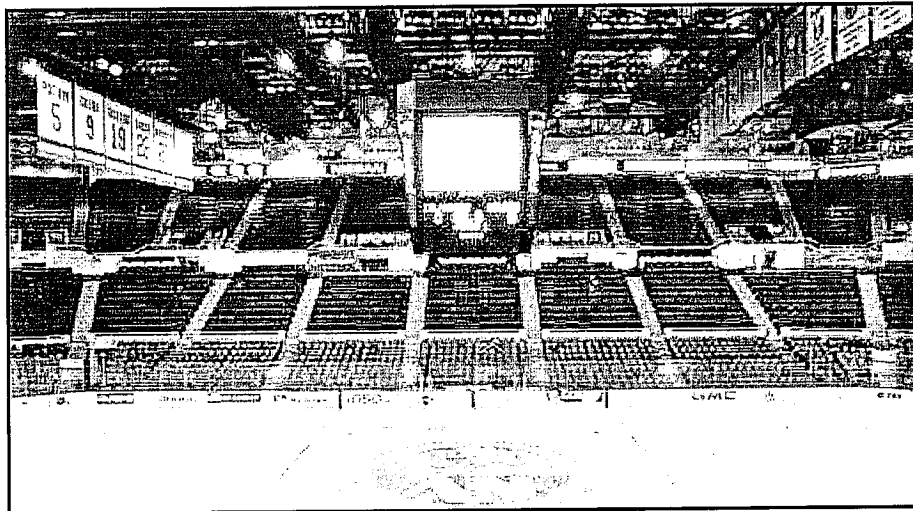

PREPARED FOR: *J. Justin Griffin, Esq.
Ku & Mussman, P.A.
176 Route 304, 2nd Floor
Bardonia, New York 10954*

PREPARED BY: *John P. Cunningham Jr., P.E.
356 Depot Hill Road
Poughquag, New York 12570
(845) 222-8699 (c) (845) 724-4735 (h)
Email: JPCJR9@aol.com*

February 4, 2009

J. Justin Griffin, Esq.
Ku & Mussman, P.A.
176 Route 304, 2nd Floor
Bardonia, New York 10954

Accessibility Consulting Services for Ku & Mussman, P.A.
Nassau Veterans Memorial Coliseum
1255 Hempstead Turnpike, Uniondale, New York 11553
Case No. CV-07-4811

Mr. Griffin:

Enclosed is a summary of my observations and findings regarding accessibility compliance for the property and facilities at 1255 Hempstead Turnpike, Uniondale, NY 115533 ("facility"). The report herein summarizes my observations of the facility during a site inspection on Wednesday, January 14, 2009, with regard to Title II and Title III of the Americans with Disabilities Act, Public Law 101-336, 28 CFR Part 35 and 36 – Nondiscrimination on the Basis of Disability by Public Accommodations and in Commercial Facilities, public entities, and the requirements of the ADA Accessibility Guidelines for Buildings and Facilities – July 1, 1994, and Department of Justice related guides and bulletins (collectively the "ADA")¹.

Please note that I visited the facility on two separate occasions - November 13, 2008 and January 14, 2009. The initial visit was comprised solely of an examination of the exterior and public areas of the facility. On the subsequent visit I inspected the interior of the facility and some portions of the exterior. This report shall focus exclusively on the inspection of January 14, 2009.

My comments are made in observance of the aforementioned ADA guidelines², which outline the following³:

- Private businesses that provide goods or services to the public are called public accommodations in the ADA. The ADA establishes requirements for twelve categories of public accommodations, including stores and shops, restaurants and bars, service establishments, theaters, hotels, recreation facilities, private museums and schools and others. Nearly all types of private businesses that serve the public are included in the categories, regardless of size.
- Public accommodations must comply with basic nondiscrimination requirements that prohibit exclusion, segregation, and unequal treatment. They also must comply with specific requirements related to architectural standards for new and altered buildings; reasonable modifications to policies, practices, and procedures; effective communication with people with hearing, vision, or speech disabilities; and other access requirements. Additionally, public accommodations must remove barriers in existing buildings where it is easy to do so without much difficulty or expense, given the public accommodation's resources.
- Public Entities, or government run bodies, may not exclude and/or deny persons with disabilities the benefits of its services, programs, and/or activities and must ensure program access. They

¹ The undersigned was not asked to evaluate the subject property with regard to accessibility compliance with New York State, Nassau County, or Town of Hempstead laws and/or codes.

² The observations noted in this report and any comments and or recommendations are made to provide informal guidance to the reader as to what the site conditions are as they existed at the time of inspection. This report does not constitute a legal interpretation of the statute.

³ ADA Guide for Small Businesses, fourth printing, June 1999.

must comply with specific requirements related to architectural standards for new and altered buildings; reasonable modifications to policies, practices, and procedures; effective communication with people with hearing, vision, or speech disabilities; and other access requirements.

- When deciding which barriers to remove first, the ADA suggests that you first provide access to the business from public sidewalks, parking, and public transportation and then provide access to the areas where goods and services are made available to the public. Once these barriers are removed, the ADA suggests that you should provide access to public toilet rooms. When these barriers have been removed, it may be necessary to remove any remaining barriers including those that limit use of public telephones and drinking fountains.

The ADA guidelines note that the obligation to engage in readily achievable barrier removal is a continuing one. Accordingly, barrier removal that was not readily achievable may later be required because of changed circumstances. Readily achievable is defined as easily accomplishable and able to be carried out without much difficulty or expense. In determining whether an action is readily achievable, factors for consideration include:

- The nature and cost of the action needed under this part;
- The overall financial resources of the site or sites involved in the action; the number of persons employed at the site; the effect on expenses and resources; legitimate safety requirements that are necessary for safe operation, including crime prevention measures; or the impact otherwise of the action upon the operation of the site;
- The geographic separateness, and the administrative or fiscal relationship of the site or sites in question to any parent corporation or entity;
- If applicable, the overall financial resources of any parent corporation or entity; the overall size of the parent corporation or entity with respect to the number of its employees; the number, type, and location of its facilities, and;
- If applicable, the type of operation or operations of any parent corporation or entity, including the composition, structure, and functions of the workforce of the parent corporation or entity.

Although the obligation to engage in readily achievable barrier removal is clearly a continuing duty under ADA guidelines, the Department of Justice ("DOJ") has declined to establish any independent requirement for an annual assessment or self-evaluation. It is best left to the public accommodations subject to § 36.304 to establish policies to assess compliance that are appropriate to the particular circumstances faced by the wide range of public accommodations covered under the ADA. However, even in the absence of an explicit regulatory requirement for periodic self-evaluations, the DOJ still urges public accommodations to implement procedures for an ongoing assessment of their compliance with the ADA's barrier removal requirements.

Furthermore, no analysis or survey has been made of the following:

- Concealed or unknown conditions or characteristics of the facility.
- Those parts of the ADA which deal with employment policies and practices, customer services, transportation issues and telecommunications.
- Areas that I have been unable to review.

- The intensity, candela, of neither the strobe lights nor the volume, decibel ratings, of an audible alarm system if one was provided.
- Seating capacity charts and wheelchair accessible designated seating charts for hockey games were requested at the time of inspection from the facility representatives, but I was denied this information.
- Customer service counters adjacent to Gates 3 and 4 were closed. I requested that they be opened during the inspection, but the facility representatives refused inspection access to these areas.
- "Supersol" was completely closed off, and access was denied by the facility representatives at the time of inspection (see photos 2320, 2321 attached below).
- "Kidzone Area" was completely closed off, and access was denied by the facility representatives at the time of inspection (see photos 2334, 111 attached below).
- Most water fountains were non-functioning or in the off position at the time of inspection, and the facility representatives did not turn them on; thus, I was unable to examine if the water output was sufficient in most cases. On the one fountain that did work, the flow was observed as inadequate (2" of flow).

With the foregoing established, please find enclosed my observations and findings with respect to the subject facility.

Sincerely,

J.P. Cunningham Jr., P.E.

Enclosures: - Executive Summary
 - Tabular Report & Photos

**ACCESSIBILITY EVALUATION SURVEY
Nassau Veterans Memorial Coliseum
Facility Interior
1-14-08**

*1255 Hempstead Turnpike
Uniondale, NY 12553*

Summary of Findings & Recommendations:

- ❖ See enclosed confidential report table with an inspection date of January 14, 2009.
- ❖ See enclosed thumbnail summary of pictures taken during the inspection of January 14, 2009 to be used as reference in reviewing my findings. All photo numbers referenced refer to the final three (3) numbers located directly beneath each photograph. Please Note that not all of the photographs included within this report are referenced within the tabular report.
- ❖ A total of **one hundred twenty seven (127 EACH)** items were observed that deviated from the ADA Accessibility Guidelines for Buildings and Facilities – July 1, 1994.
- ❖ A total estimated cost of **\$140,550.00** would seemingly be required to complete the necessary remedies for compliance with the ADA Accessibility Guidelines for Buildings and Facilities – July 1, 1994. This estimate is based upon reasonable assumptions for applicable labor and material rates for the area of inspection.

ADA Report
Confidential

Nassau Veterans Memorial Coliseum

Insp. Date: 11-13-08
Insp. by: John Paul Cunningham, PE

Area Of Condition	Condition	ADAAG	Recommendation	Photo	Est. Cost
1 Parking North Side Field 1	Handicap Sign is bent and not in accordance with section A4.6.4 Signage	A4.6.4 4.30.6	Fix sign post or replace sign post with new one	724	\$100.00
2 Parking North Side Field 1	Handicap Signs are missing on two (2) support poles	4.1.2(7)(a) 4.30.7(a)	Replace missing signs	722,732	\$200.00
3 Parking North Side Field 1	There are no Handicap signs that have "Van accessible" mounted below the symbol of accessibility.	4.1.2(5)(b) 4.6.3	Install "Van accessible" signs Based on item #8 below, there should be a total of a minimum of 22 "van accessible" parking locations. Eleven (11) should be provided here and Eleven (11) additional in the South Side Parking lot. (See item #8 Below)	722,723	\$1,000.00
4 Parking Field 1	Handicap Painted Symbols are very faint or non existent	4.30.4 4.30.7(a)	Re-stripe all the handicap parking symbols	725, 729-731 012	\$6,000.00
5 Parking South Side Field 5	Handicap Sign is bent and not in accordance with section A4.6.4 Signage	A4.6.4 4.30.6	Fix sign post or replace sign post with new one	032	\$100.00
6 Parking South Side Field 5	There are no Handicap signs that have "Van accessible" mounted below the symbol of accessibility.	4.1.2(5)(b) 4.6.3	Install "Van accessible" signs Based on item #9 below, there should be a total of a minimum of 22 "van accessible" parking locations. Eleven (11) should be provided here and Eleven (11) additional in the North Side Parking lot. (See item #3 Above)	032, 033, 035	\$1,000.00
7 Parking West Side VIP	No Handicap Parking spaces in VIP/Press Parking Lot	4.6.2 4.3	Reconstruct striping and add proper signage to depict handicap accessible parking in this area	008	\$2,000.00
8 Parking Overall	There are not enough handicap parking spaces. Per ADA regulations, at least 170 Handicap parking spaces are required (Depending on the actual capacity of the arena. 16,000 capacity used for this example) Only 80 parking spaces are designated as handicap.	4.1.2(5)(a)	Depending on the actual capacity of the arena, the required amount of additional handicap spaces need to be added. At a minimum, ninety (90) more spaces are necessary based upon the "required minimum number of accessible spaces" as outlined in section 4.1.2(5)(a)	N/A	\$16,000.00
9 Van Accessible Parking Locations	There are not enough van accessible parking spaces. Per section 4.1.2 (5)(b) 22 van accessible spots are required.	4.1.2(5)(b)	Add necessary van accessible handicap spaces when adding handicap spaces per item #8	N/A	Included in item #8 above
10 Drop off Area	No Accessible Handicap Ramp along drop off area on west side of building Only ramp has a 2" lip	4.6.6 4.3, 4.7, 4.8	Construct handicap accessible ramp to comply with ADA sections 4.3, 4.7 and 4.8	N/A	\$3,000.00
11 HC ramp #1 on South Side South Side	Accessible Route to Coliseum Reveal at curb varies up to 1" reveal.	4.5.2	Repair the transition between the curb and the pavement so that there is less than 1/4" reveal or less than a 1/2 reveal with a beveled edge	040, 041, 043, 044	\$300.00
12 HC Ramp #2 on South Side South Side	Accessible Route to Coliseum Reveal at curb varies up to 1 1/4" reveal.	4.5.2	Repair the transition between the curb and the pavement so that there is less than 1/4" reveal or less than a 1/2 reveal with a beveled edge	047-050	\$300.00
13 HC Ramp #4 on South Side Entrance at the end of lot Southwest corner	Handicap sign and with crosswalk, but no handicap parking		Reconfigure striping of parking lot to include handicap parking spaces	055	\$4,000.00
14 HC Ramp #4 on South Side Entrance at the end of lot Southwest corner	Ramp condition is poor. Concrete has multiple serious cracks		Repair the ramp with new concrete	051,054	\$3,000.00
15 Northeast Corner Near Entry Gate 4-6	Curb reveal is up to 1 1/4" (and consistently above 1/2")	4.52	Repair the transition between the curb and the pavement so that there is less than 1/4" reveal or less than a 1/2 reveal with a beveled edge	026-027	\$500.00
16 Northeast Corner Near Entry Gate 4-6	Ramp slope is 8.8%	4.7.2 4.8.2	Reconstruct Ramp to ensure slope does not exceed 8.3%	024-025	\$2,000.00
17 Northeast Corner Near Entry Gate 4-6	Only ramp has a 2" curb reveal	4.5.2	Reconstruct Ramp to have a reveal of no greater than 1/2"	010	\$300.00
18 East Side Drop off area By Gates 7-10 and 11-14	Only ramp has a minimum 1 1/2" curb reveal	4.5.2	Reconstruct Ramp to have a reveal of no greater than 1/2"	031, 032	\$400.00
19 Outside Bathroom Trailer	There is no handicap access as the only way to enter the bathrooms is to climb up 5 stairs.	4.3.2(2) 4.3.8 4.5.2	Reconfigure stairs to include a ramp or install additional bathrooms that are accessible.	738, 739	\$2,000.00
20 Entrance Doorways	There are numerous locations where the threshold exceeds 1/2" in height. At least five (5) locations are 7/8" or more and one measured at 1 1/8".	4.13.8	Repair all threshold areas that exceed 1/2" in height	N/A	\$2,000.00
21 Seating Areas Outside	Neither Seating Area has Handicap Accessible Seating as the seating is all Picnic Tables Each of the seating areas have 28 tables and none are accessible.	5.2	Per section 5.2 provide two (2) handicap tables at each location.	738 - 740	\$1,500.00
22 Concrete Floor Outside in Picnic Areas	Concrete needs repairs at multiple locations. There are 1" + drops from edge of slabs to edge of slabs and in failed repair areas.	4.5.2	Repair all areas to comply with 4.5.2	966 - 988	\$2,000.00
23 Outside Bar	The counter is inaccessible as it is 40 1/4" in height throughout	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	N/A	\$500.00
24 Access from Public Transportation	There is no accessible handicap access from public transportation stops on hemstead turnpike.	4.3.2	Provide access from public transportation. Possibly add accessible transport during events. (per event cost given)	N/A	\$1,900.00

Estimated Total: \$50,100.00

ADA Report
Confidential

Nassau Veterans Memorial Coliseum

Insp. Date: 1-28-09
Insp. by: John Paul Cunningham, P.E.

Area Of Condition	Condition	ADAAG	Recommendation	Photo	Est. Cost
1	Protruding Objects Throughout the Primary Corridor	Various Objects attached to walls protrude into the corridor more than 4"	4.4.1 Relocate or Modify various objects location or height to adhere to section 4.4.1	990	\$ 1,500.00
2	Pay Phone banks throughout site	Many of the telephone banks were blocked by various movable objects	4.31.2 Relocate objects to allow for clear floor space in front of telephones.	2331 937 2264, 2270	\$50.00
3	Ticket Booth Counters	All Ticket Booth Counters have a counter height of 42 3/8"	7.2 (2) Modify counters) or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	742, 751-756	\$1,000.00
4	Guest Service Counter	Guest Service Counter has a height of 41 1/8"	7.2 (2) Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	757-758	\$1,000.00
5	Personalization Station Islander Jersey Counter	Counter has a height of 40 1/8"	7.2 (1) Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	746-749	\$1,000.00
6	Handicap Seating Areas	According to section 4.1.3 (19) for a place of assembly with 16,000 seats (estimated attendance although some correspondence states 18,000) 161 wheelchair locations are required. The Coliseum has 4 wheelchair accessible seating sections, specifically in gate 4, 10, 12 and 15. Based on the space requirements for wheelchair seating spaces in series in section 4.33, the Coliseum has 44 wheelchair accessible seats, significantly less the minimum 161 required. Additionally, the Nassau Coliseum website states under its policy section, "...Please not that disabled seating is very limited, especially for wheelchairs."	4.1.3 (19) Install additional Handicap Seating locations throughout the venue. Approx \$450/seat to add 117 seats, ave. 4.33.1 4.33.2	764,770,774 776,779,782 809,810	\$52,650.00
7	Handicap Seating Areas	All Wheelchair seating areas are located on the same level and do not allow people with physical disabilities a choice of different seating options.	4.33.3 Install additional Handicap Seating locations at different seating elevations throughout the venue.	768,783 792,798	Included in number 23 above
8	Handicap Seating Areas	Wheelchair Seating areas do not allow for seating of at least one companion next to each wheelchair seating area. There is not ample room for seating next to the wheelchair and the Nassau coliseum website states under its policy section, "...You may purchase up to (2) two companion seats in a folding chair to sit behind the wheelchair patron"	4.33.3 Install additional Handicap Seating locations throughout the venue.	764,770,774 776,779,782 809,810	Included in number 23 above
9	Handicap Seating Areas	Wheelchair Seating areas do not provide for sufficient fixed seating of companions. Section 4.33.3 states, "...At least one companion fixed seat shall be provided next to each wheelchair seating area..."	4.33.3 Add additional fixed seating locations with the additional handicap seating locations necessary	764,770,774 776,779,782 809,810	Included in number 23 above
10	Men's Bathroom - Gate 2	Entry Door 1 does not have a minimum clear opening of 32" Width is 29"	4.13.5 Figure 24 (b) Reconstruct Entry Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	813, 818 819,820	\$1,500.00
11	Men's Bathroom - Gate 2	Entry Door 2 does not have a minimum clear opening of 32"	4.13.5 Figure 24 (b) Reconstruct Entry Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	N/A	\$1,500.00
12	Men's Bathroom - Gate 2	Exit Door 1 does not have a minimum clear opening of 32" Width is 29"	4.13.5 Figure 24 (b) Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	821, 822	\$1,500.00
13	Men's Bathroom - Gate 2	Exit Door 2 does not have a minimum clear opening of 32" Width is 28 1/2"	4.13.5 Figure 24 (b) Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	821, 825	\$1,500.00
14	Men's Bathroom - Gate 2	Pipes under sinks are exposed.	4.19.4 Insulate pipes under sinks or construct a barrier under sinks to protect wheelchair patron from contact.	828 - 830	\$500.00
15	Men's Bathroom - Gate 2	Sinks does not provide a clearance of at least 29" above the finish floor to the bottom of the apron	4.19.2 Figure 31 Reconfigure height of at least one sink to provide a minimum of 29" from the finish floor to the bottom of the apron.	830, 831	\$400.00
16	Men's Bathroom - Gate 2	Sinks does not provide a clearance of at least 27" above the finish floor for knee clearance.	4.19.2 Figure 31 Reconfigure height of sinks to provide a minimum of 27" from the finish floor to the bottom of the sink.	830, 831	Included in number 32 above
17	Men's Bathroom - Gate 2	Sinks do not have sufficient clear floor space. Sinks are 26 1/2" apart (centerline to centerline) and this does not meet the 30" minimum criteria	4.19.3 4.2.4 4.23.6 Reconfigure all the sinks to provide a minimum of 30" clear floor space between each sink.	840, 841, 842	Included in number 32 above
18	Men's Bathroom - Gate 2	Mirror is set too high. The bottom edge of the reflecting surface is 42 7/8" above the finish floor.	4.19.6 4.23.6 Remount mirror to the wall with the bottom edge of the reflecting surface no higher than 40 inches above the finish floor.	845, 846, 847	\$300.00
19	Men's Bathroom - Gate 2	Urinals are mounted too high. Eight (8) Urinals are set at 24" and One (1) Urinal is set at 20".	4.18.2 4.23.5 4.22.5 Reconfigure height of the lower (20") urinal to a maximum of 17" above finish floor.	852,853,854 857	\$400.00
20	Men's Bathroom - Gate 2	Grab Bar configuration not in compliance with Fig 30 (b). End of Grab Bars on both walls are not 54" minimum from back wall. Right Bar is 51 1/2" and left bar is 53" from back wall.	4.17.3 Fig 30(b) Reconfigure Grab Bars to adhere to figure 30(b).	861-865	\$200.00
21	Men's Bathroom - Gate 2	Handicap stall is not acceptable size. Figure 30 depicts various size stall layouts, but none of them are met. Stall is 40" wide by 56 1/2" long.	4.17.3 Figure 30 (b) Reconfigure the handicap stall to comply with Figure 30.	858,862,872 874	\$1,000.00
22	Men's Bathroom - Gate 2	A second stall with Grab Bars is not provided per 4.23.4 "Where 6 or more stalls are provided, in addition to the stall complying with 4.17.3, at least one stall 36 inches wide with an outward swing, self-closing door and parallel grab bars complying with fig. 30(d) and 4.26 shall be provided".	4.23.4 4.26 Reconfigure a stall to comply with 4.23.4	858	\$1,000.00
23	Men's Bathroom - Gate 18	Entry Door 1 does not have a minimum clear opening of 32" Width is 30"	4.13.5 Figure 24 (b) Reconstruct Entry Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	878,879,881	\$1,500.00
24	Men's Bathroom - Gate 18	Entry Door 2 does not have a minimum clear opening of 32" Width is 30"	4.13.5 Figure 24 (b) Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	878,879,882	\$1,500.00
25	Men's Bathroom - Gate 18	Exit Door 1 does not have a minimum clear opening of 32" Width is 28 3/4"	4.13.5 Figure 24 (b) Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	893,894,895	\$1,500.00

ADA Report
Confidential

Nassau Veterans Memorial Coliseum

Insp. Date: 1-28-09
Insp. by: John Paul Cunningham, P.E.

26	Men's Bathroom - Gate 18	Exit Door 2 does not have a minimum clear opening of 32"	4.13.5 Figure 24 (b)	Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	893	\$1,500.00
27	Men's Bathroom - Gate 18	Pipes under sinks are exposed.	4.19.4	Insulate pipes under sinks or construct a barrier under sinks to protect wheelchair patron from contact.	884 similar to 828-830	\$500.00
28	Men's Bathroom - Gate 18	Sinks does not provide a clearance of at least 29" above the finish floor to the bottom of the apron	4.19.2 Figure 31 4.23.6	Reconfigure height of at least one sink to provide a minimum of 29" from the finish floor to the bottom of the apron.	similar to 830, 831	\$400.00
29	Men's Bathroom - Gate 18	Sinks does not provide a clearance of at least 27" above the finish floor for knee clearance.	4.19.2 Figure 31 4.23.6	Reconfigure height of sinks to provide a minimum of 27" from the finish floor to the bottom of the sink.	similar to 830, 831	Included in number 32 above
30	Men's Bathroom - Gate 18	Sinks do not have sufficient clear floor space. Sinks are 26 1/2" apart (centerline to centerline) and this does not meet the 30" minimum criteria	4.19.3 4.2.4 4.23.6	Reconfigure all the sinks to provide a minimum of 30" clear floor space between each sink.	similar to 840, 841, 842	Included in number 32 above
31	Men's Bathroom - Gate 18	Mirror is set too high. The bottom edge of the reflecting surface is 42 1/2" above the finish floor.	4.19.6 4.23.6	Remount mirror to the wall with the bottom edge of the reflecting surface no higher than 40 inches above the finish floor.	similar to 845, 846, 847	\$300.00
32	Men's Bathroom - Gate 18	Urinals are mounted too high. Eight (8) Urinals are set at 24" and One (1) Urinal is set at 20".	4.18.2 4.23.5 4.22.5	Reconfigure height of the lower (20") urinal to a maximum of 17" above finish floor.	similar to 852,853,854 857	\$400.00
33	Men's Bathroom - Gate 18	Grab Bar configuration not in compliance with Fig 30 (b). End of Grab Bars on both walls are not 54" minimum from back wall. Right Bar is 51 1/2" and left bar is 53" from back wall.	4.17.3 Fig 30(b)	Reconfigure Grab Bars to adhere to figure 30(b).	similar to 861-865	\$200.00
34	Men's Bathroom - Gate 18	Handicap stall is not acceptable size. Figure 30 depicts various size stall layouts, but none of them are met. Stall is 40" wide by 56" long.	4.17.3 Figure 30 (b)	Reconfigure the handicap stall to comply with Figure 30.	similar to 859,862,872	\$1,000.00
35	Men's Bathroom - Gate 18	A second stall with Grab Bars is not provided per 4.23.4 "Where 6 or more stalls are provided, in addition to the stall complying with 4.17.3, at least one stall 36 inches wide with an outward swing, self-closing door and parallel grab bars complying with fig. 30(d) and 4.26 shall be provided".	4.23.4 4.26	Reconfigure a stall to comply with 4.23.4	892	\$1,000.00
36	Men's Bathroom - Gate 12	Entry Door 1 does not have a minimum clear opening of 32" Width is 30"	4.13.5 Figure 24 (b)	Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	897,898	\$1,500.00
37	Men's Bathroom - Gate 12	Entry Door 2 does not have a minimum clear opening of 32" Width is 30 1/4"	4.13.5 Figure 24 (b)	Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	897,899	\$1,500.00
38	Men's Bathroom - Gate 12	Exit Door 1 does not have a minimum clear opening of 32" Width is 29"	4.13.5 Figure 24 (b)	Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	910,911	\$1,500.00
39	Men's Bathroom - Gate 12	Exit Door 2 does not have a minimum clear opening of 32"	4.13.5 Figure 24 (b)	Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	910	\$1,500.00
40	Men's Bathroom - Gate 12	Pipes under sinks are exposed.	4.19.4	Insulate pipes under sinks or construct a barrier under sinks to protect wheelchair patron from contact.	900	\$500.00
41	Men's Bathroom - Gate 12	Sinks does not provide a clearance of at least 29" above the finish floor to the bottom of the apron	4.19.2 Figure 31 4.23.6	Reconfigure height of at least one sink to provide a minimum of 29" from the finish floor to the bottom of the apron.	similar to 830, 831	\$400.00
42	Men's Bathroom - Gate 12	Sinks does not provide a clearance of at least 27" above the finish floor for knee clearance.	4.19.2 Figure 31 4.23.6	Reconfigure height of sinks to provide a minimum of 27" from the finish floor to the bottom of the sink.	similar to 830, 831	Included in number 32 above
43	Men's Bathroom - Gate 12	Sinks do not have sufficient clear floor space. Sinks are 26 1/2" apart (centerline to centerline) and this does not meet the 30" minimum criteria	4.19.3 4.2.4 4.23.6	Reconfigure all the sinks to provide a minimum of 30" clear floor space between each sink.	similar to 840, 841, 842	Included in number 32 above
44	Men's Bathroom - Gate 12	Mirror is set too high. The bottom edge of the reflecting surface is 42 1/2" above the finish floor.	4.19.6 4.23.6	Remount mirror to the wall with the bottom edge of the reflecting surface no higher than 40 inches above the finish floor.	similar to 845, 846, 847	\$300.00
45	Men's Bathroom - Gate 12	Urinals are mounted too high. Eight (8) Urinals are set at 24" and One (1) Urinal is set at 20".	4.18.2 4.23.5 4.22.5	Reconfigure height of the lower (20") urinal to a maximum of 17" above finish floor.	similar to 852,853,854 857	\$400.00
46	Men's Bathroom - Gate 12	Grab Bar configuration not in compliance with Fig 30 (b). End of Grab Bars on both walls are not 54" minimum from back wall. Right Bar is 51 1/2" and left bar is 53" from back wall.	4.17.3 Fig 30(b)	Reconfigure Grab Bars to adhere to figure 30(b).	906 similar to 861-865	\$200.00
47	Men's Bathroom - Gate 12	Handicap stall is not acceptable size. Figure 30 depicts various size stall layouts, but none of them are met. Stall is 41" wide by 56" long.	4.17.3 Figure 30 (b)	Reconfigure the handicap stall to comply with Figure 30.	902 similar to	\$1,000.00
48	Men's Bathroom - Gate 12	A second stall with Grab Bars is not provided per 4.23.4 "Where 6 or more stalls are provided, in addition to the stall complying with 4.17.3, at least one stall 36 inches wide with an outward swing, self-closing door and parallel grab bars complying with fig. 30(d) and 4.26 shall be provided".	4.23.4 4.26	Reconfigure a stall to comply with 4.23.4	similar to 892	\$1,000.00
49	Men's Bathroom - Gate 8	Entry Door 1 does not have a minimum clear opening of 32" Width is 30"	4.13.5 Figure 24 (b)	Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	915-917	\$1,500.00
50	Men's Bathroom - Gate 8	Entry Door 2 does not have a minimum clear opening of 32" Width is 30"	4.13.5 Figure 24 (b)	Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	915	\$1,500.00
51	Men's Bathroom - Gate 8	Exit Door 1 does not have a minimum clear opening of 32" Width is 28 1/2 "	4.13.5 Figure 24 (b)	Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	926 similar to 822, 825	\$1,500.00
52	Men's Bathroom - Gate 8	Exit Door 2 does not have a minimum clear opening of 32"	4.13.5 Figure 24 (b)	Reconstruct Exit Door to have a minimum clear opening of 32" with the door open 90 degrees, measured between the face of the door and the opposite stop.	926 similar to 822, 825	\$1,500.00
53	Men's Bathroom - Gate 8	Pipes under sinks are exposed.	4.19.4	Insulate pipes under sinks or construct a barrier under sinks to protect wheelchair patron from contact.	900	\$500.00
54	Men's Bathroom - Gate 8	Sinks does not provide a clearance of at least 29" above the finish floor to the bottom of the apron	4.19.2 Figure 31 4.23.6	Reconfigure height of at least one sink to provide a minimum of 29" from the finish floor to the bottom of the apron.	similar to 830, 831	\$400.00
55	Men's Bathroom - Gate 8	Sinks does not provide a clearance of at least 27" above the finish floor for knee clearance.	4.19.2 Figure 31 4.23.6	Reconfigure height of sinks to provide a minimum of 27" from the finish floor to the bottom of the sink.	similar to 830, 831	Included in number 32 above
56	Men's Bathroom - Gate 8	Sinks do not have sufficient clear floor space. Sinks are 26 1/2" apart (centerline to centerline) and this does not meet the 30" minimum criteria	4.19.3 4.2.4 4.23.6	Reconfigure all the sinks to provide a minimum of 30" clear floor space between each sink.	similar to 840, 841, 842	Included in number 32 above

ADA Report
Confidential

Nassau Veterans Memorial Coliseum

Insp. Date: 1-28-09
Insp. by: John Paul Cunningham, P.E.

57	Men's Bathroom - Gate 8	Mirror is set too high. The bottom edge of the reflecting surface is 42 1/2" above the finish floor.	4.19.6 4.23.6	Remount mirror to the wall with the bottom edge of the reflecting surface no higher than 40 inches above the finish floor.	similar to 845, 846, 847	\$300.00
58	Men's Bathroom - Gate 8	Urinals are mounted too high. Eight (8) Urinals are set at 24 1/4" and One (1) Urinal is set at 21 1/4". These Urinals are different than the ones at gates 2, 18 and 12.	4.18.2 4.23.5 4.22.5	Reconfigure height of the lower (20") urinal to a maximum of 17" above finish floor.	similar to 852, 853, 854, 857	\$400.00
59	Men's Bathroom - Gate 8	Grab Bar configuration not in compliance with Fig 30 (b). End of Grab Bars on both walls are not 54" minimum from back wall. Right Bar is 51 1/2" and left bar is 53" from back wall.	4.17.3 Fig 30(b)	Reconfigure Grab Bars to adhere to figure 30(b).	906 similar to 861-865	\$200.00
60	Men's Bathroom - Gate 8	Handicap stall is not acceptable size. Figure 30 depicts various size stall layouts, but none of them are met.	4.17.3 Figure 30 (b)	Reconfigure the handicap stall to comply with Figure 30.	902 similar to 858, 862, 872	\$1,000.00
61	Men's Bathroom - Gate 2	A second stall with Grab Bars is not provided per 4.23.4 "Where 6 or more stalls are provided, in addition to the stall complying with 4.17.3, at least one stall 36 inches wide with an outward swing, self-closing door and parallel grab bars complying with fig. 30(d) and 4.26 shall be provided".	4.23.4 4.26	Reconfigure a stall to comply with 4.23.4	similar to 892	\$1,000.00
62	Brewhouse 1 Portable Sales Counter	The serving counter is inaccessible as it is 48" above finished floor. The lower portion of the counter is still inaccessible as it is 36" above finished floor.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	934-936	\$500.00
63	Newsday 1 Portable Sales Counter	The counter is inaccessible as it is 48 3/4" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	943, 944	\$500.00
64	Napkin Dispenser Near Gate 7	Napkin Dispenser at Condiment counter is 62" high, which is too high.	4.2.5 4.2.6	Modify Dispenser to have a maximum high side reach of 54" or a maximum forward reach of 48".	947, 948, 949	\$100.00
65	Napkin Dispenser Near Gate 6	Napkin Dispenser at Condiment counter is 63" high, which is too high.	4.2.5 4.2.6	Modify Dispenser to have a maximum high side reach of 54" or a maximum forward reach of 48".	952	\$100.00
66	D&B Portable Sales Counter Near Gate 5	The counter is inaccessible as it is 48 3/4" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	953, 954	\$500.00
67	Wraps Dogs 1 Between Gates 4 and 5	The counter is inaccessible as it is 42 7/8" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	955-957	\$1,500.00
68	New York Islanders 1 Portable Sales Counter	The counter is inaccessible as it is 49" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	960	\$500.00
69	Sweet Tooth Sales Counter	The counter is inaccessible as it is 35 7/8" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	961, 962	\$500.00
70	Super Pretzel 1 Portable Sales Counter	The counter is inaccessible as it is 40" in height at its lowest point.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	963, 964	\$500.00
71	Cotton Candy Sales Counter	The counter is inaccessible as it is 36 1/2" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	966, 967	\$500.00
72	Brewhouse 2 Portable Sales Counter	The serving counter is inaccessible as it is 48" above finished floor. The lower portion of the counter is still inaccessible as it is 36" above finished floor.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	970	\$500.00
73	Portable Sales Counter (Blank)	The counter is inaccessible as it is 49" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	971	\$500.00
74	Edy's Ice Cream 1 Portable Sales Counter	The counter is inaccessible as it is 46" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	973 - 975	\$500.00
75	Beer by Gate 2 Portable Sales Counter	The counter is inaccessible as it is 39 1/2" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	976	\$500.00
76	Collectible/Merchandise Sales Counter	The counter is inaccessible as it is 40" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	N/A	\$500.00
77	Napkin Dispenser Near Gate 2	Napkin Dispenser at Condiment counter is 61" high, which is too high.	4.2.5 4.2.6	Modify Dispenser to have a maximum high side reach of 54" or a maximum forward reach of 48".	977	\$100.00
78	3 Napkin Dispensers Near Gate 1	Napkin Dispenser at Condiment counter is 54 1/2" high, which is too high.	4.2.5 4.2.6	Modify Dispenser to have a maximum high side reach of 54" or a maximum forward reach of 48".	978	\$150.00
79	Soda and Pretzel Portable Sales Counter	The counter is inaccessible as it is 49" in height on top of the glass protection case. There is a lower counter, but it blocked by the register.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	979	\$500.00
80	Knuckleheads West	The Bar counter is inaccessible as it is 44 3/4" high, which is too high.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	980, 981, 985	\$1,000.00
81	The Grill	The counter is inaccessible as it is 43 1/2" height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	2317 - 2319	\$1,000.00
82	BBQ Pit	The counter is inaccessible as it is 49 1/4" in height on top of the glass protection case. There is a lower counter, but it blocked by the register.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	2322, 2323	\$500.00
83	Brewhouse 3 Portable Sales Counter Near Gate 18	The serving counter is inaccessible as it is 48" above finished floor. The lower portion of the counter is still inaccessible as it is 36" above finished floor.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	2327-2330 2324	\$500.00
84	Edy's Ice Cream 2 Portable Sales Counter Near Gate 18	The counter is inaccessible as it is 45 3/4" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	2332, 2333	\$500.00
85	Premio 1 Portable Sales Counter	The serving area is inaccessible as it is 55" in height on top of the glass protection. There is a lower area on the side of the counter, but it is 39 1/2", still inaccessible.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	088-090	\$500.00
86	Savor Market	The counter is inaccessible as it is 42 1/2" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	091 - 094	\$500.00
87	Napkin Dispenser Near Gate 16	Napkin Dispenser at Condiment counter is 61" high, which is too high.	4.2.5 4.2.6	Modify Dispenser to have a maximum high side reach of 54" or a maximum forward reach of 48".	095, 096	\$100.00
88	Islander Team Store Between gates 16 and 15	The counter is inaccessible as it is 42 1/2" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	97, 99, 100	\$500.00
89	Wraps Dogs 2 Near Gate 14	The counter is inaccessible as it is 42 1/2" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	102, 105, 106	\$1,500.00

ADA Report
Confidential

Nassau Veterans Memorial Coliseum

Insp. Date: 1-28-09
Insp. by: John Paul Cunningham, P.E.

90	Napkin Dispenser Near Wrap Dog Gate 14	Napkin Dispenser at Condiment counter is 61" high, which is too high.	4.2.5 4.2.6	Modify Dispenser to have a maximum high side reach of 54" or a maximum forward reach of 48".	101	\$100.00
91	Edy's Ice Cream 2 Portable Sales Counter Near Gate 18	The counter is inaccessible as it is 46" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	107, 108	\$500.00
92	Brewhouse 4 Portable Sales Counter Near Gate 13	The serving counter is inaccessible as it is 48" above finished floor. The lower portion of the counter is still inaccessible as it is 36" above finished floor.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	110	\$500.00
93	Daruma of Toyko	The counter is inaccessible as it is 47" in height throughout the whole front.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	115, 117 - 119	\$500.00
94	Dashers	The counter is inaccessible as it is 36 1/2" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	122, 123	\$500.00
95	Napkin Dispenser Near Gate 12	Napkin Dispenser at Condiment counter is 62 12" high, which is too high.	4.2.5 4.2.6	Modify Dispenser to have a maximum high side reach of 54" or a maximum forward reach of 48".	125	\$100.00
96	Napkin Dispenser Near Gate 11	Napkin Dispenser at Condiment counter is 62 12" high, which is too high.	4.2.5 4.2.6	Modify Dispenser to have a maximum high side reach of 54" or a maximum forward reach of 48".	126	\$100.00
97	The Works	The counter is inaccessible as it is 42 1/2" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	127 - 129	\$500.00
98	New York Islanders 2 Portable Sales Counter	The counter is inaccessible as it is 49" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	130	\$500.00
99	New York Islanders 3 Portable Sales Counter	The counter is inaccessible as it is 49" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	130, 131	\$500.00
100	Newsday 2 Portable Sales Counter	The counter is inaccessible as it is 49" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	131	\$500.00
101	Edy's Ice Cream 3 Portable Sales Counter Near Gate 11	The counter is inaccessible as it is 45 1/2" in height throughout.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	136, 137	\$500.00
102	Knuckleheads East	The Bar counter is inaccessible as it is 44 1/2" high, which is too high.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	138, 139	\$1,000.00
103	Steak Break Portable Sales Counter	The counter is inaccessible as it is 49" in height on top of the glass protection case. There is a lower counter, but it blocked by the register.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	136, 137	\$500.00
104	New York Islanders 4 Portable Sales Counter	The counter is inaccessible as it is 49" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	141	\$500.00
105	Brewhouse 5 Portable Sales Counter Near Gate 13	The serving counter is inaccessible as it is 48" above finished floor. The lower portion of the counter is still inaccessible as it is 36" above finished floor.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	143	\$500.00
106	The Nutty Bavarian Portable Sales Counter	The serving counter is inaccessible as it is 39 3/4" above finished floor to the lower portion of the counter. The actual serving area above the glass protection is higher.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	149, 150 153, 154	\$500.00
107	Coors Light Sales Counter	The counter is inaccessible as it is 44 1/2" at the higher level and 36 3/4" at the lower level.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	155 - 157	\$500.00
108	Premio 1 Portable Sales Counter	The serving area is inaccessible as it is 55" in height on top of the glass protection. There is a lower area on the side of the counter, but it is 39 1/2", still inaccessible.	5.2	Modify or replace counter to provide a counter height 34" or lower for food and beverages, per section 5.2	N/A	\$500.00
109	Elevator	Height of call button in lobby on top floor is 31"	4.10.3	Modify call buttons in upstairs elevator lobby so that it is centered at 42" above the floor, per section 4.10.3	N/A	\$1,000.00
110	Elevator	Inside width is only 47 1/2"	4.10.9	Alter Elevator dimensions to comply with 4.10.9, which requires a minimum of 51" inside width clearance	N/A	\$10,000.00
111	Men's Bathroom Downstairs	Sinks does not provide a clearance of at least 27" above the finish floor for knee clearance.	4.19.2 Figure 31	Reconfigure height of sinks to provide a minimum of 27" from the finish floor to the bottom of the sink.	2287	Included in number 32 above
112	Men's Bathroom Downstairs	Mirror is set too high. The bottom edge of the reflecting surface is 42 3/4" above the finish floor.	4.19.6 4.23.6	Remount mirror to the wall with the bottom edge of the reflecting surface no higher than 40 inches above the finish floor.	2287	\$300.00
113	Men's Bathroom Downstairs	Urinals are mounted too high. One of the Eight urinals is set low, but at 20" it is still set too high.	4.18.2 4.23.5 4.22.5	Reconfigure height of the lower urinal to a maximum of 17" above finish floor.	2285 2289	\$400.00
114	Men's Bathroom Downstairs	Grab Bars are 32 1/4" above the finished floor.	4.17.3 Fig 30(b)	Reconfigure Grab Bars to adhere to figure 30(b) with a height of 33" - 36".	2291	\$200.00
115	Men's Bathroom Downstairs	Toilet Bowl height is 14 3/4" with seat up and 15 3/4" with seat down.	4.17.3 Fig 30(d)	Reset Toilet Bowl so height is between 15" and 17" as per figure 30(d).	2291	\$200.00
116	Men's Bathroom Downstairs	Handicap stall is not acceptable size. Figure 30 depicts various size stall layouts, but none of them are met. Handicap stall is 40 3/4" wide by 56" long.	4.17.3 Figure 30 (b)	Reconfigure the handicap stall to comply with Figure 30.	2291	\$1,000.00


ADA Report
Confidential


Nassau Veterans Memorial Coliseum

Insp. Date: 1-28-09
Insp. by: John Paul Cunningham, P.E.

117	Men's Bathroom Downstairs	Grab Bar configuration not in compliance with Fig 30 (b). Grab Bars are 48" and 36" long and both not 42" minimum as per Fig 30 (b).	4.17.3 Fig 30(b)	Reconfigure Grab Bars to adhere to figure 30(b).	2291	\$200.00
118	Men's Bathroom Downstairs	Pipes under sinks are exposed.	4.19.4	Insulate pipes under sinks or construct a barrier under sinks to protect wheelchair patron from contact.	2287	\$500.00
119	Downstairs Concession Area	The counters are inaccessible as they are between 38 1/4" and 42" in height.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	2306	\$1,500.00
120	Downstairs Concession Area	Napkin Dispenser between concession counters is 56 12" high, which is too high.	4.2.5 4.2.6	Modify Dispenser to have a maximum high side reach of 54" or a maximum forward reach of 48".	125	\$100.00
121	Downstairs Eating Area	None of the seats in the seating area are handicap accessible.	4.1.3(18) 4.32	Establish access by constructing a ramp in compliance with section 4.8	2297, 2299 2301, 2302	\$1,500.00
122	Downstairs Eating Area	There is no handicap access to elevated eating area as both entrances to area have a 7" step	4.3.2(2) 4.3.8 4.5.2	Establish access by constructing a ramp in compliance with section 4.8	2297, 2299 2301, 2302	Included in # 140 above
123	Doolin's Pub	The counter is inaccessible as it is 49" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	2293 992	\$1,500.00
124	Bistro 1255	The counter is inaccessible as it is 43 3/8" in height throughout.	7.2 (1)	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	N/A	\$1,500.00
125	Bistro 1255	None of the 12 seats at the bar are handicap accessible.	4.1.3(18) 4.32	Modify counter or install an alternate counter to provide a height not to exceed 36" AFF with length of at least 36".	N/A	Included in #143 above
126	Door to SMG office (along access path to elevator)	The Door Hardware is not in compliance with 4.13.9	4.13.9	Reconfigure door hardware to adhere to section 4.13.9.	995	\$200.00
127	Water Fountains	Most of the water fountains were turned off, but the one that was working only had a flow of water of 2" high.	4.15.3	Adjust spout so that the spout provides a flow of water at least 4" high, per section 4.15.3 Check all other fountains to ensure they comply as well	336,336	\$200.00

Estimated Total: \$140,550.00

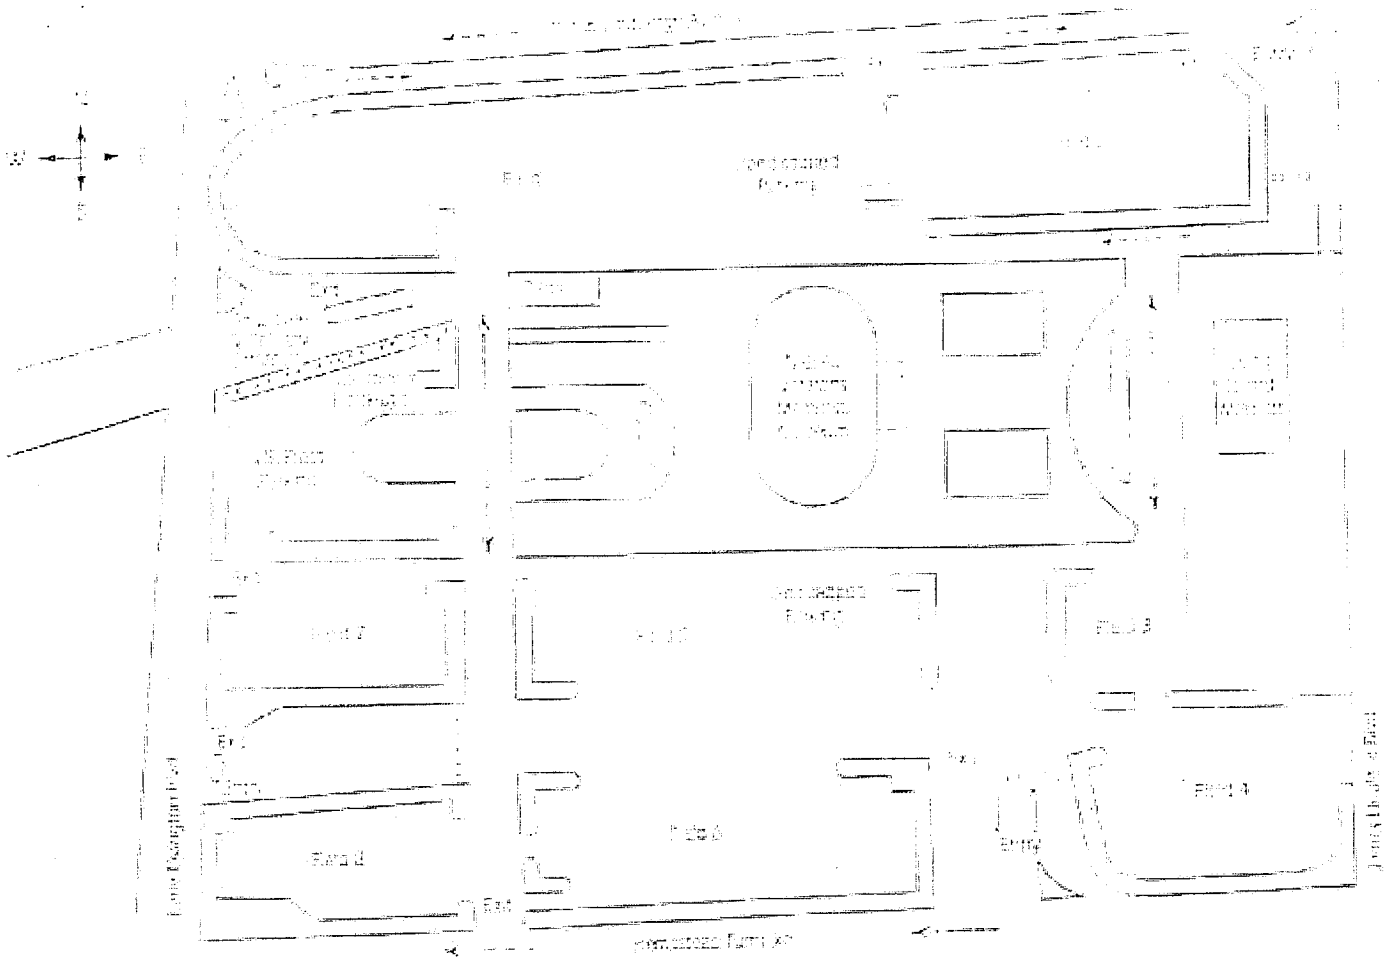


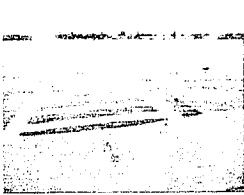


P1020044.JPG




P1020045.JPG

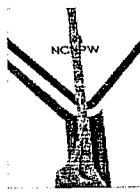

P1020046.JPG

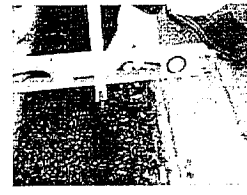

P1020047.JPG

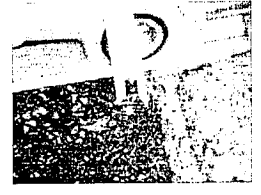


P1020048.JPG



P1020049.JPG




P1020050.JPG

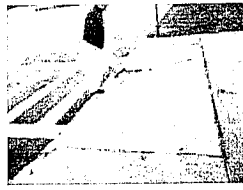


P1020051.JPG




P1020052.JPG

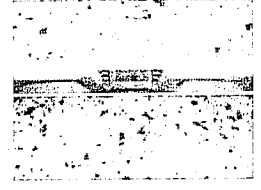

P1020053.JPG

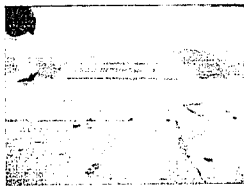

P1020054.JPG

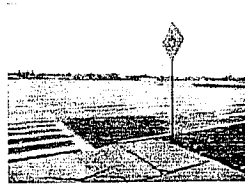

P1020055.JPG




P1020032.JPG




P1020033.JPG




P1020034.JPG

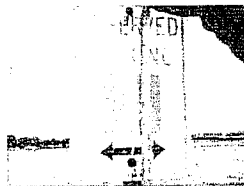

P1020035.JPG

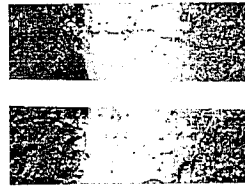


P1020036.JPG

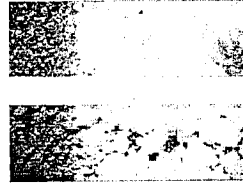


P1020037.JPG




P1020038.JPG

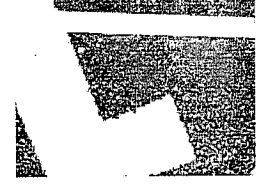

P1020039.JPG

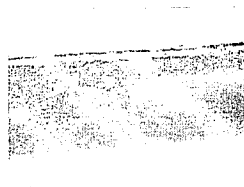

P1020040.JPG

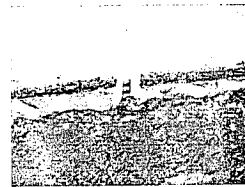


P1020041.JPG




P1020042.JPG




P1020043.JPG

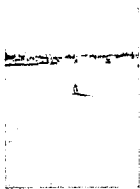


P1020722.JPG

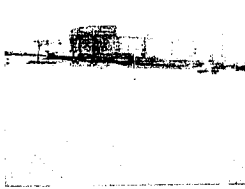


P1020723.JPG

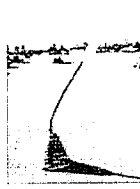

P1020724.JPG

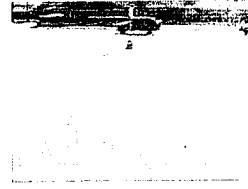

P1020725.JPG

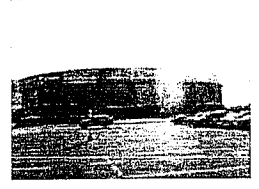


P1020726.JPG




P1020727.JPG




P1020728.JPG

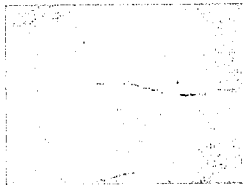

P1020729.JPG

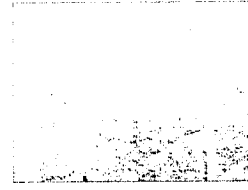


P1020730.JPG

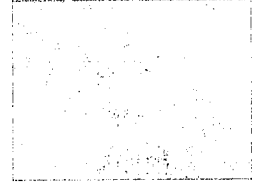


P1020731.JPG



P1020732.JPG

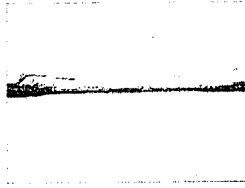

P1020733.JPG

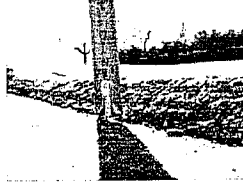


P1020734.JPG




P1020735.JPG




P1020736.JPG

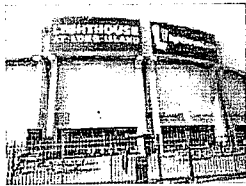


P1020737.JPG

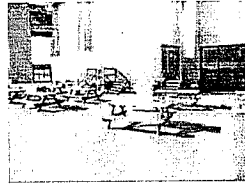


P1020738.JPG

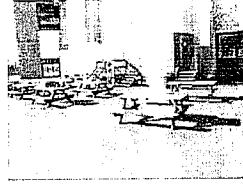


P1020739.JPG

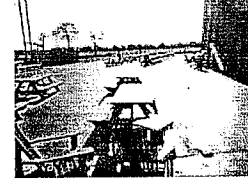


P1020740.JPG

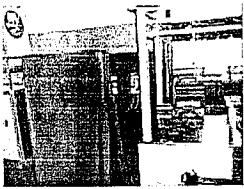

102_2264.JPG

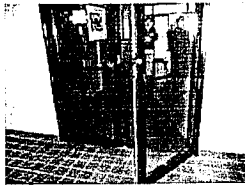

P1020995.JPG

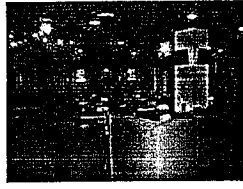

P1020994.JPG




P1020993.JPG




P1020992.JPG



P1020991.JPG

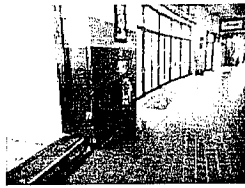

P1020990.JPG

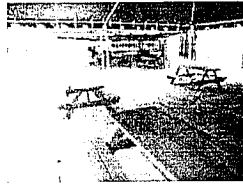

P1020989.JPG




P1020988.JPG



P1020987.JPG



P1020986.JPG

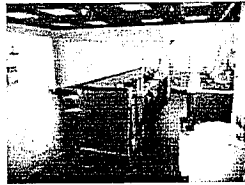


P1020985.JPG




P1020984.JPG



P1020983.JPG

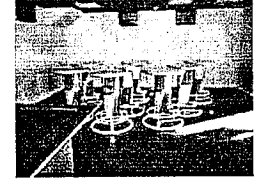

P1020982.JPG

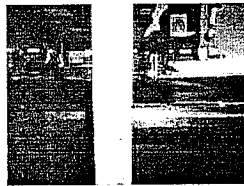


P1020981.JPG




P1020980.JPG




P1020979.JPG

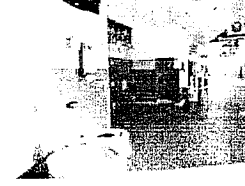

P1020978.JPG

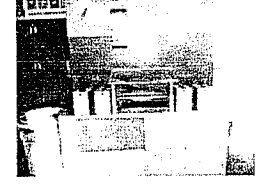

P1020977.JPG

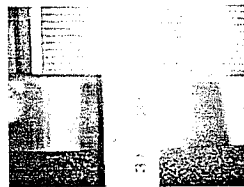

P1020976.JPG




P1020975.JPG



P1020974.JPG




P1020973.JPG

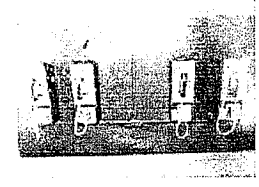

P1020972.JPG




P1020971.JPG

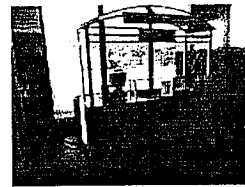

P1020970.JPG



P1020969.JPG

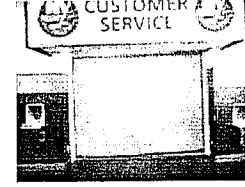


P1020968.JPG




P1020967.JPG




P1020966.JPG

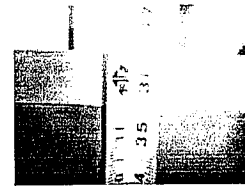

P1020965.JPG

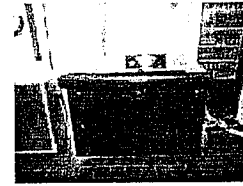


P1020964.JPG

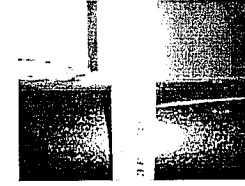

P1020963.JPG




P1020962.JPG

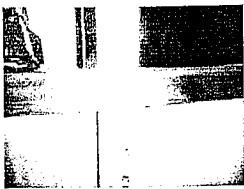


P1020961.JPG




P1020960.JPG

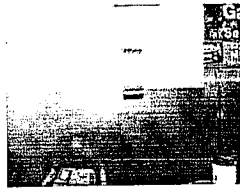

P1020959.JPG

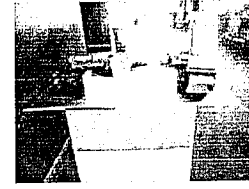


P1020958.JPG

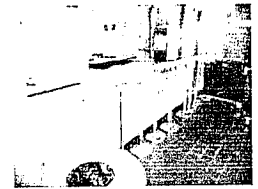


P1020957.JPG



P1020956.JPG

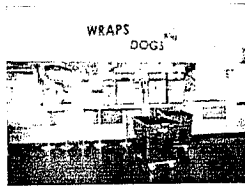

P1020955.JPG

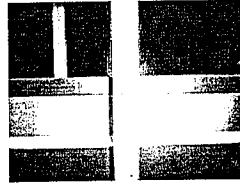


P1020954.JPG




P1020953.JPG




P1020952.JPG

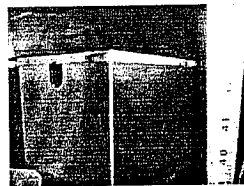


P1020951.JPG

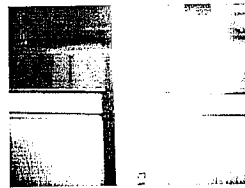


P1020950.JPG

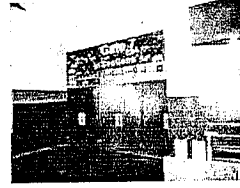


P1020949.JPG

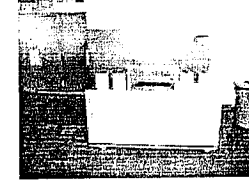


P1020948.JPG

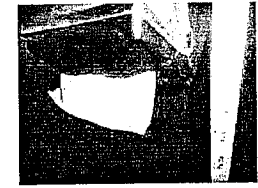


P1020947.JPG

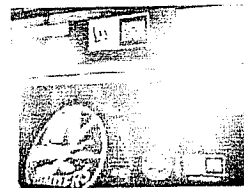


P1020946.JPG

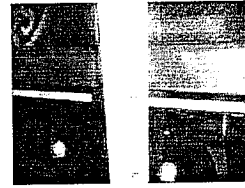

P1020945.JPG

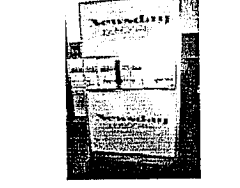


P1020944.JPG

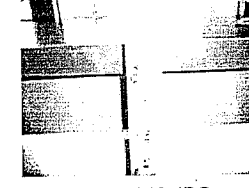


P1020943.JPG




P1020942.JPG

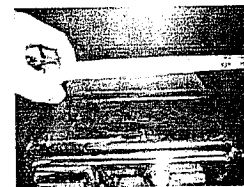


P1020941.JPG

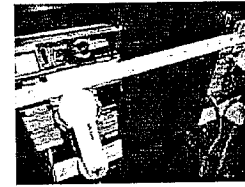

P1020940.JPG

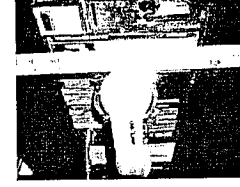

P1020939.JPG

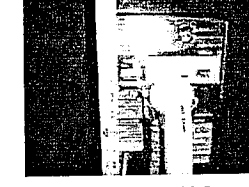

P1020938.JPG



P1020937.JPG



P1020936.JPG




P1020935.JPG




P1020934.JPG




P1020933.JPG

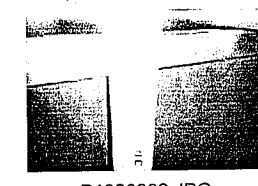


P1020932.JPG

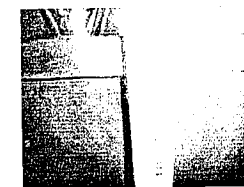


P1020931.JPG

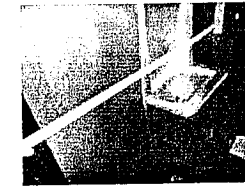


P1020930.JPG

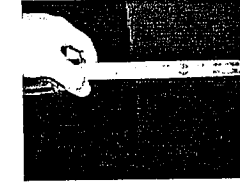

P1020929.JPG

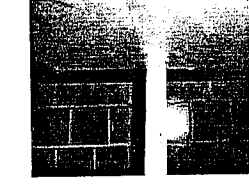

P1020928.JPG

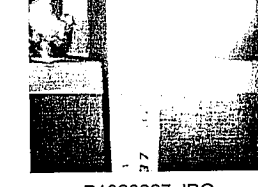


P1020927.JPG




P1020891.JPG




P1020890.JPG

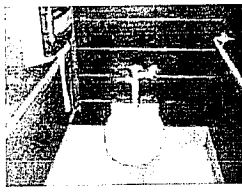

P1020889.JPG

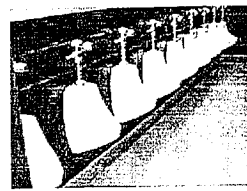


P1020888.JPG

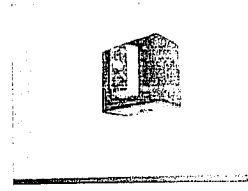


P1020887.JPG




P1020886.JPG

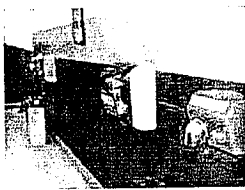


P1020885.JPG

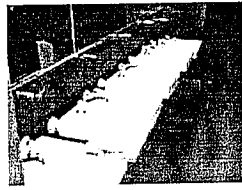


P1020884.JPG

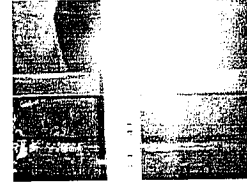

P1020883.JPG

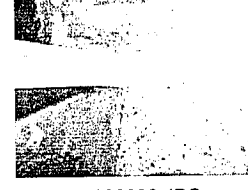


P1020882.JPG

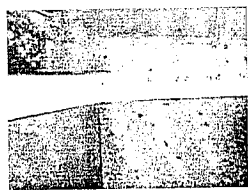

P1020881.JPG




P1020880.JPG

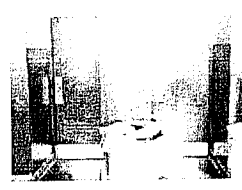

P1020879.JPG




P1020878.JPG

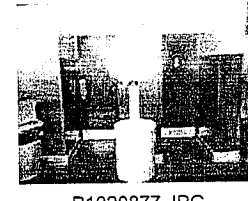


P1020877.JPG




P1020876.JPG

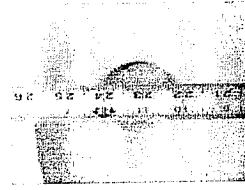

P1020875.JPG

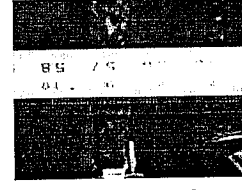


P1020874.JPG

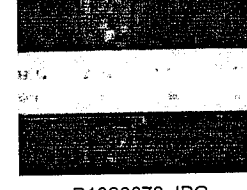


P1020873.JPG



P1020872.JPG

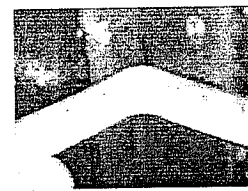

P1020871.JPG

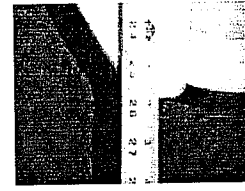


P1020870.JPG




P1020869.JPG




P1020868.JPG

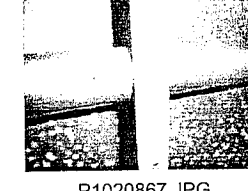


P1020867.JPG

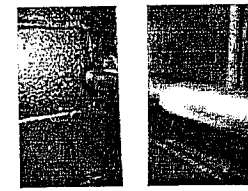


P1020866.JPG

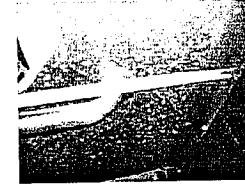

P1020865.JPG

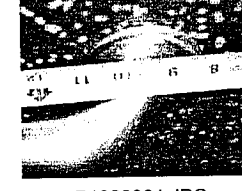


P1020864.JPG

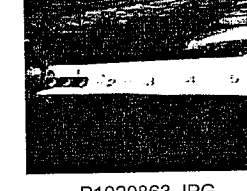

P1020863.JPG



P1020862.JPG

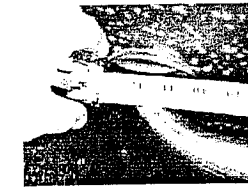

P1020861.JPG




P1020860.JPG




P1020859.JPG



P1020858.JPG

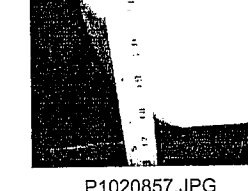

P1020857.JPG

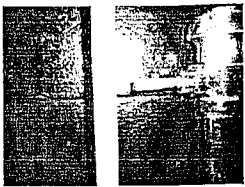

P1020856.JPG




P1020855.JPG




P1020854.JPG




P1020853.JPG

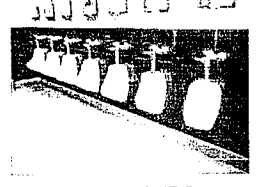


P1020852.JPG

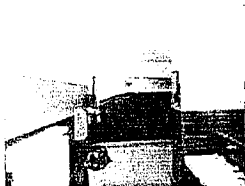


P1020851.JPG

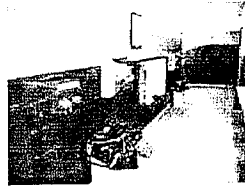


P1020850.JPG

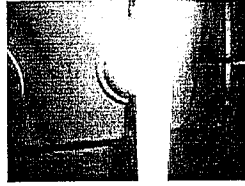

P1020849.JPG

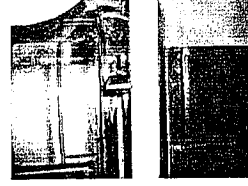


P1020848.JPG

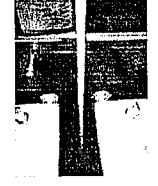

P1020847.JPG



P1020846.JPG

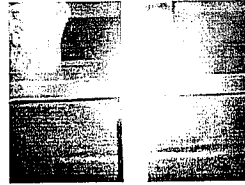

P1020845.JPG




P1020844.JPG




P1020843.JPG




P1020842.JPG

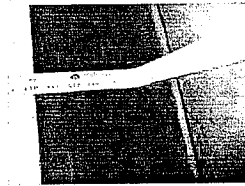


P1020841.JPG

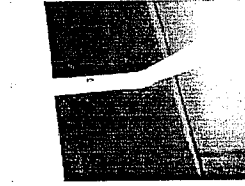


P1020840.JPG

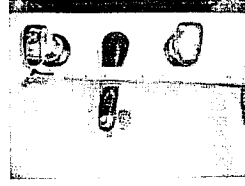

P1020839.JPG

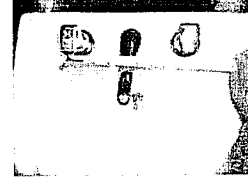


P1020838.JPG

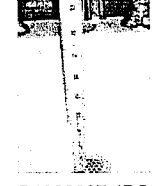


P1020837.JPG




P1020836.JPG

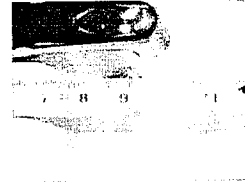

P1020835.JPG

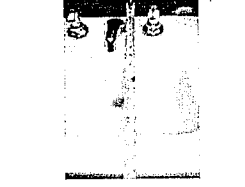


P1020834.JPG

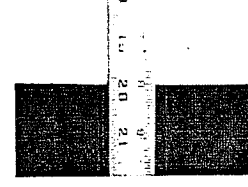


P1020833.JPG




P1020832.JPG

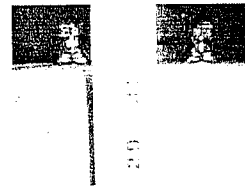

P1020831.JPG

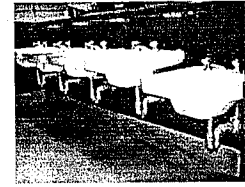

P1020830.JPG

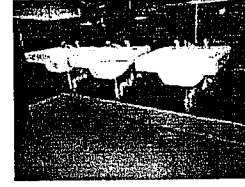

P1020829.JPG



P1020828.JPG




P1020827.JPG




P1020826.JPG




P1020825.JPG

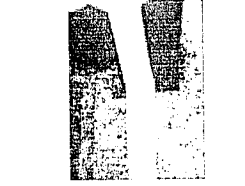


P1020824.JPG

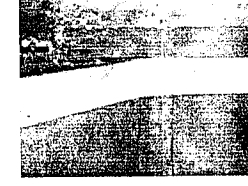


P1020823.JPG

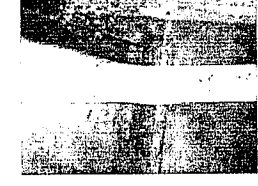

P1020822.JPG

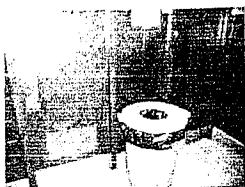

P1020821.JPG

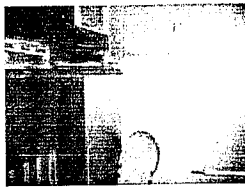

P1020820.JPG




P1020819.JPG




P1020818.JPG




P1020817.JPG

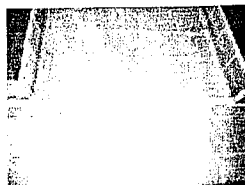

P1020816.JPG

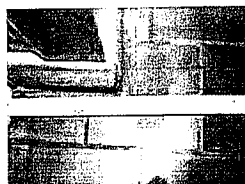


P1020815.JPG

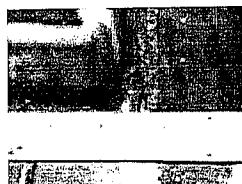


P1020814.JPG



P1020813.JPG

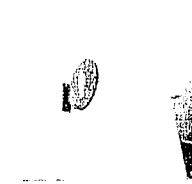

P1020812.JPG

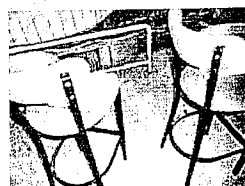

P1020811.JPG




P1020810.JPG




P1020809.JPG



P1020808.JPG

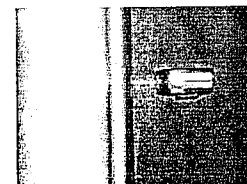


P1020807.JPG

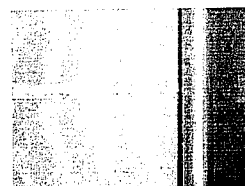

P1020806.JPG




P1020805.JPG

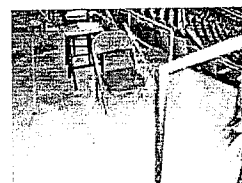

P1020804.JPG



P1020803.JPG

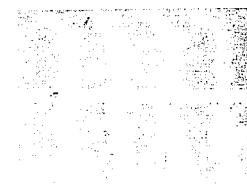

P1020802.JPG



P1020801.JPG



P1020800.JPG




P1020799.JPG



P1020798.JPG




P1020797.JPG

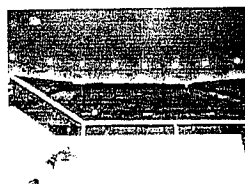

P1020796.JPG



P1020795.JPG

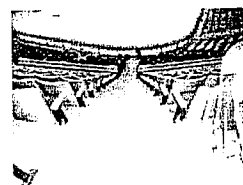

P1020794.JPG



P1020793.JPG




P1020792.JPG



P1020791.JPG



P1020790.JPG

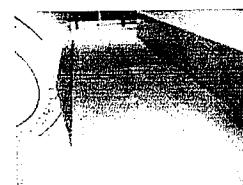


P1020789.JPG



P1020788.JPG




P1020787.JPG

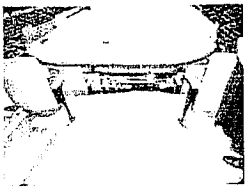

P1020786.JPG




P1020785.JPG

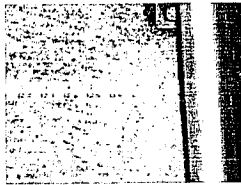


P1020784.JPG




P1020783.JPG

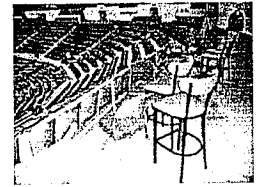

P1020782.JPG

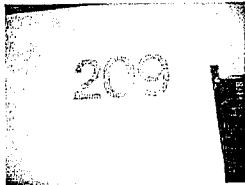

P1020781.JPG

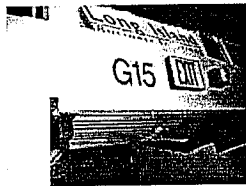


P1020780.JPG




P1020779.JPG




P1020778.JPG

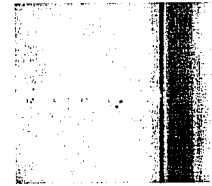


P1020777.JPG

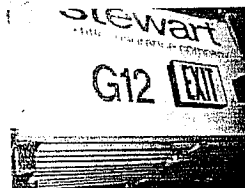

P1020776.JPG

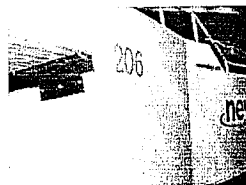

P1020775.JPG

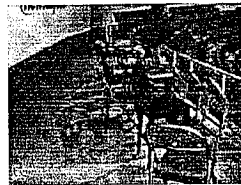

P1020774.JPG



P1020773.JPG



P1020772.JPG




P1020771.JPG



P1020770.JPG




P1020769.JPG

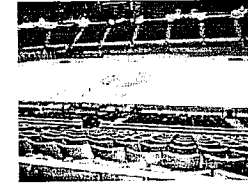

P1020768.JPG




P1020767.JPG

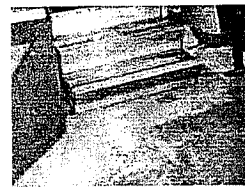

P1020766.JPG



P1020765.JPG

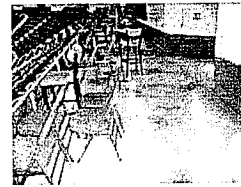


P1020764.JPG



P1020763.JPG



P1020762.JPG

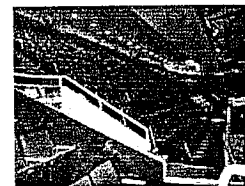


P1020761.JPG




P1020760.JPG



P1020759.JPG

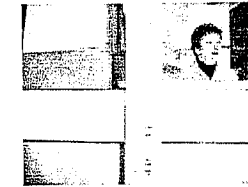

P1020758.JPG

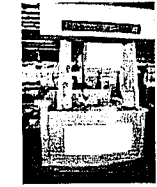


P1020757.JPG




P1020756.JPG




P1020755.JPG

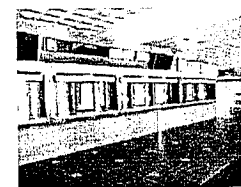


P1020754.JPG

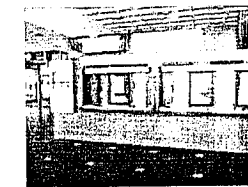

P1020753.JPG

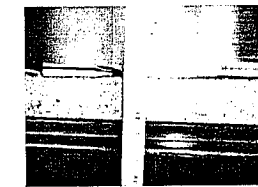


P1020752.JPG

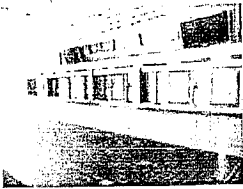


P1020751.JPG




P1020750.JPG

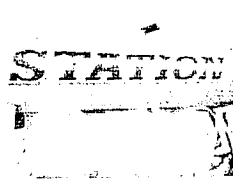


P1020749.JPG

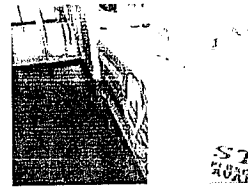


P1020748.JPG

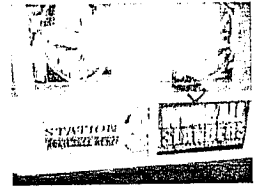

P1020747.JPG

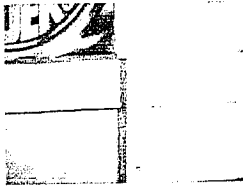


P1020746.JPG

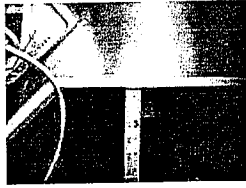


P1020745.JPG




P1020744.JPG

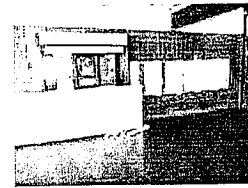


P1020743.JPG

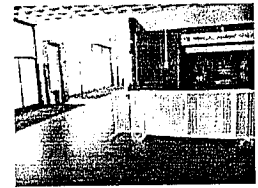


P1020742.JPG

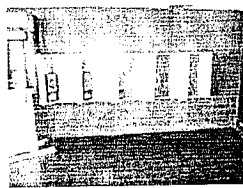

P1020741.JPG

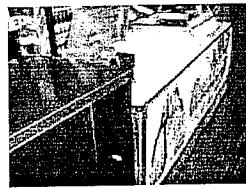

P1013157.JPG

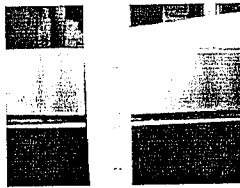


P1013156.JPG



P1013155.JPG




P1013154.JPG

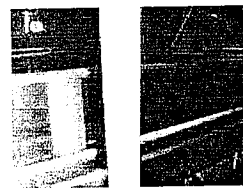


P1013153.JPG




P1013152.JPG

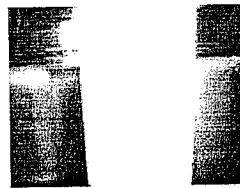


P1013151.JPG

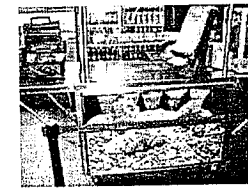


P1013150.JPG

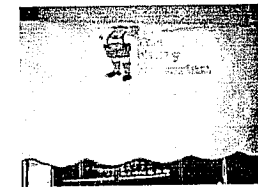

P1013149.JPG

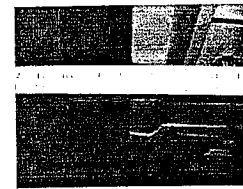


P1013148.JPG

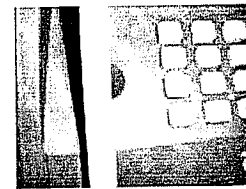


P1013147.JPG




P1013146.JPG

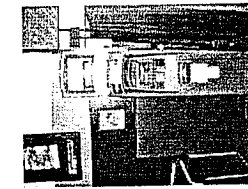


P1013145.JPG

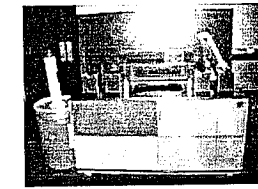


P1013144.JPG

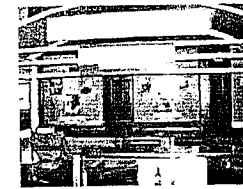


P1013143.JPG

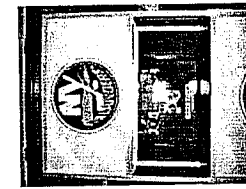


P1013142.JPG

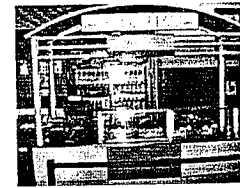

P1013141.JPG

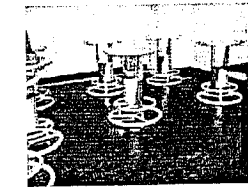


P1013140.JPG

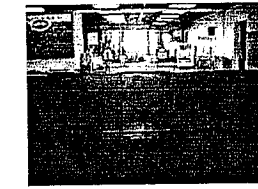


P1013139.JPG




P1013138.JPG

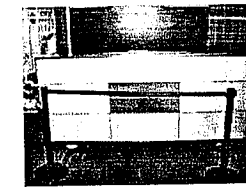


P1013137.JPG

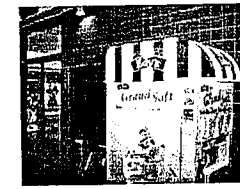


P1013136.JPG

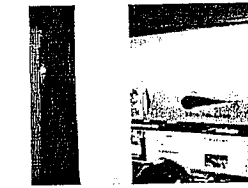

P1013135.JPG

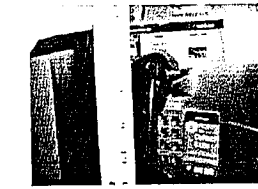


P1013134.JPG

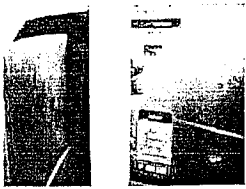


P1013133.JPG




P1013132.JPG

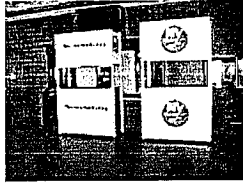


P1013131.JPG

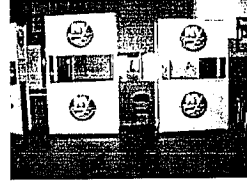


P1013130.JPG

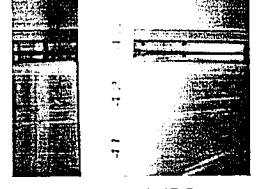


P1013129.JPG

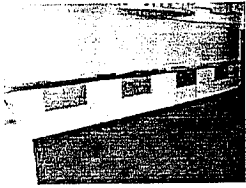


P1013128.JPG

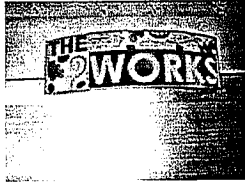


P1013127.JPG

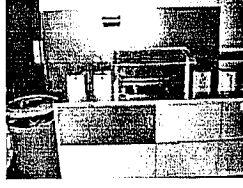


P1013126.JPG

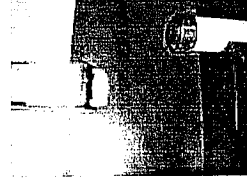

P1013125.JPG

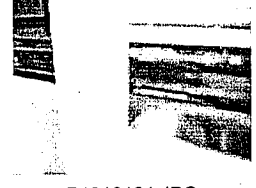


P1013124.JPG

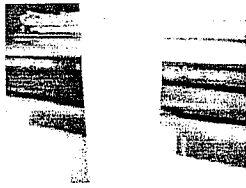

P1013123.JPG



P1013122.JPG

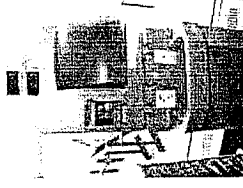


P1013121.JPG




P1013120.JPG




P1013119.JPG

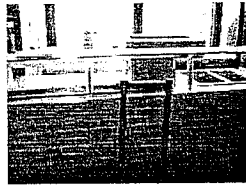

P1013118.JPG

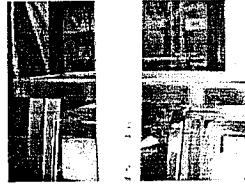

P1013117.JPG

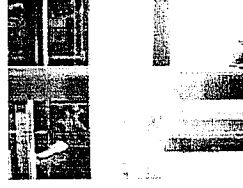


P1013116.JPG



P1013115.JPG




P1013114.JPG

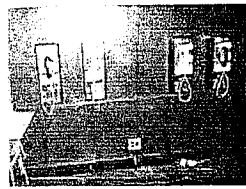

P1013113.JPG




P1013112.JPG

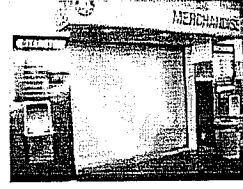


P1013111.JPG



P1013110.JPG

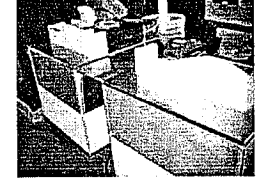


P1013109.JPG

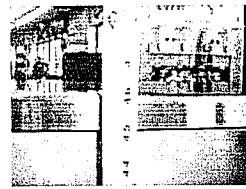

P1013108.JPG




P1013107.JPG

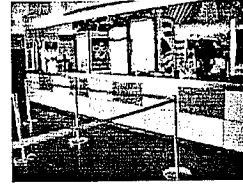


P1013106.JPG



P1013105.JPG

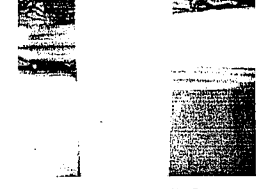

P1013104.JPG

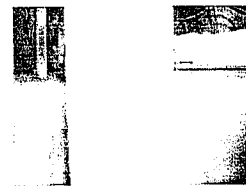

P1013103.JPG




P1013102.JPG




P1013101.JPG




P1013100.JPG

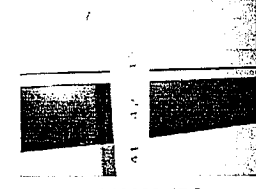


P1013099.JPG

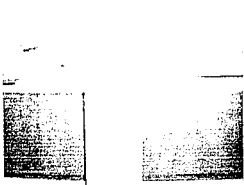

P1013098.JPG

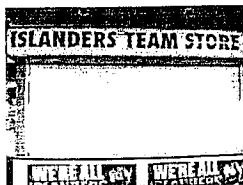


P1013097.JPG

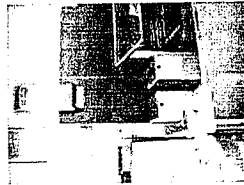


P1013096.JPG



P1013095.JPG

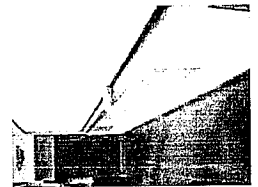

P1013094.JPG

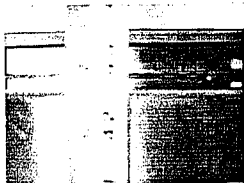

P1013093.JPG



P1013092.JPG




P1013091.JPG




P1013090.JPG




P1013089.JPG

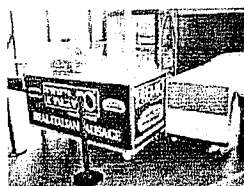


P1013088.JPG

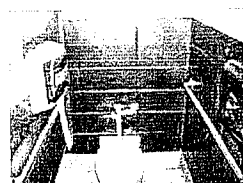

P1013087.JPG

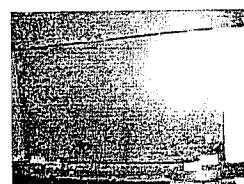

P1013086.JPG

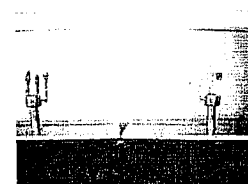

P1013085.JPG



P1013084.JPG




P1013083.JPG



P1013082.JPG




102_2336.JPG

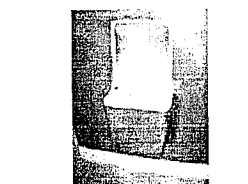


102_2335.JPG




102_2334.JPG

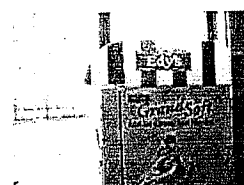

102_2333.JPG

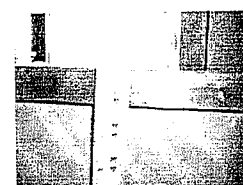


102_2332.JPG

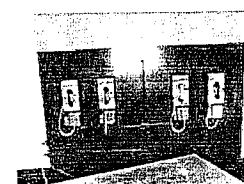

102_2331.JPG



102_2330.JPG

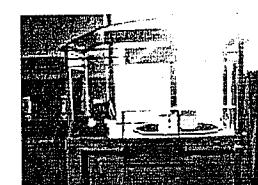


102_2329.JPG




102_2328.JPG




102_2327.JPG

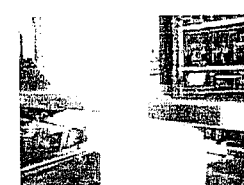


102_2326.JPG

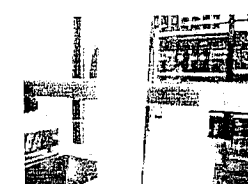

102_2325.JPG

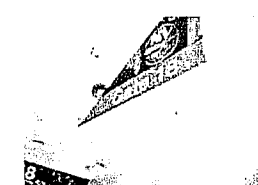


102_2324.JPG

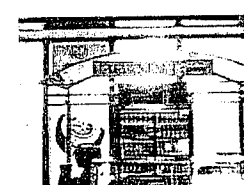

102_2323.JPG




102_2322.JPG

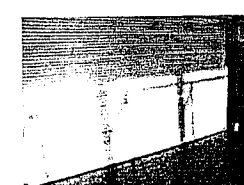

102_2321.JPG




102_2320.JPG

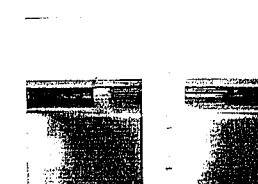


102_2319.JPG




102_2318.JPG

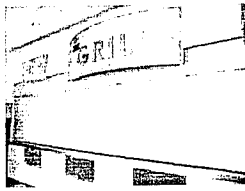


102_2317.JPG

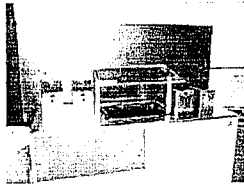


102_2316.JPG

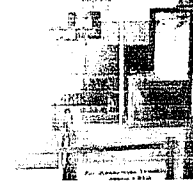


102_2315.JPG

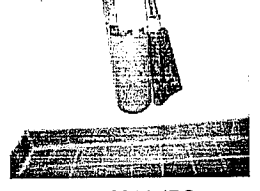


102_2314.JPG

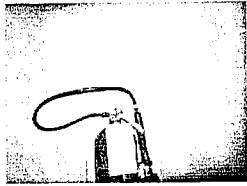

102_2313.JPG

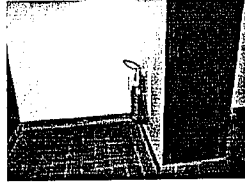

102_2312.JPG

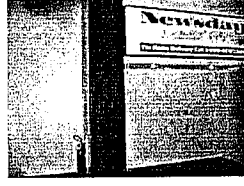


102_2311.JPG




102_2310.JPG




102_2309.JPG

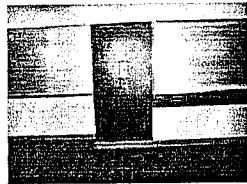

102_2308.JPG

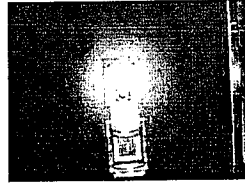

102_2307.JPG

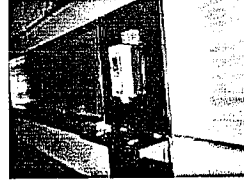


102_2306.JPG




102_2305.JPG



102_2304.JPG

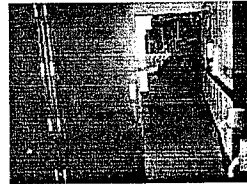


102_2303.JPG

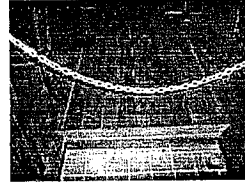

102_2302.JPG




102_2301.JPG

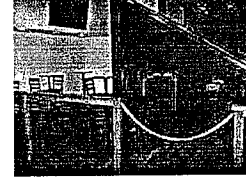


102_2300.JPG




102_2299.JPG

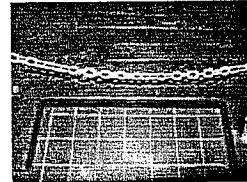


102_2298.JPG

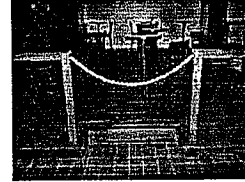


102_2297.JPG

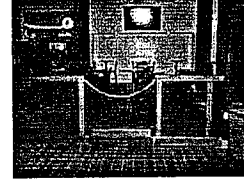


102_2296.JPG

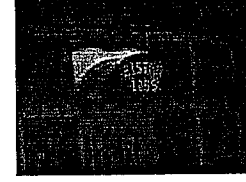


102_2295.JPG

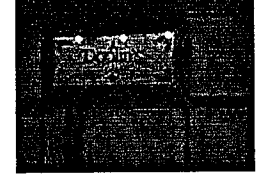


102_2294.JPG

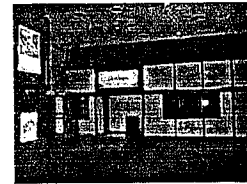


102_2293.JPG

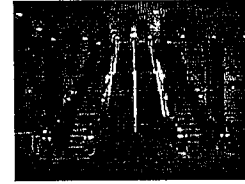

102_2292.JPG

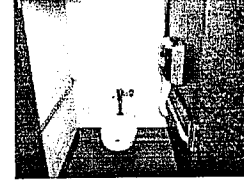

102_2291.JPG

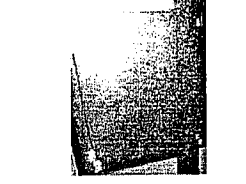

102_2290.JPG




102_2289.JPG




102_2288.JPG




102_2287.JPG

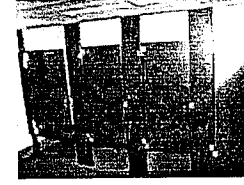

102_2286.JPG

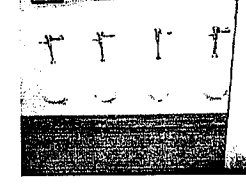


102_2285.JPG

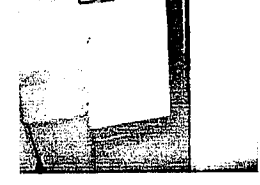


102_2284.JPG



102_2283.JPG

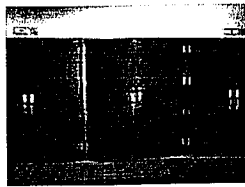


102_2282.JPG

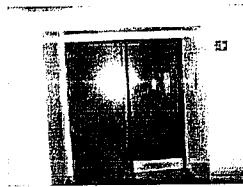


102_2281.JPG



102_2280.JPG

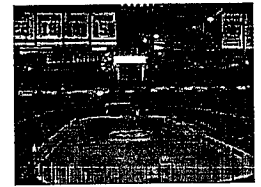

102_2279.JPG

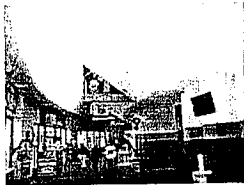

102_2278.JPG




102_2277.JPG




102_2276.JPG



102_2275.JPG

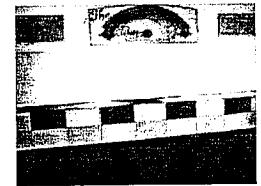


102_2274.JPG

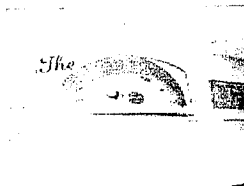

102_2273.JPG



102_2272.JPG

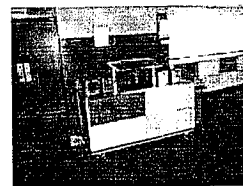

102_2271.JPG



102_2270.JPG




102_2269.JPG



102_2268.JPG



102_2267.JPG

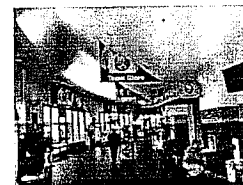

102_2266.JPG



102_2265.JPG